JUN 26 '00 14:56

FROM AMP CUSTOMER SERVICE

TO 917739075180

PAGE. 002

165,1092 + 152 3510



AMP Extraction Tool 189727-1 for Mici-Universal MATE-N-LOK* Contacts Instruction Sheet 20 JAN 95 Rev O

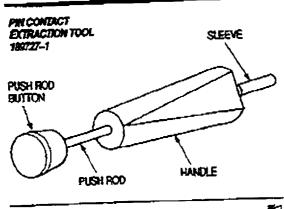


Figure 1

1. INTRODUCTION

AMP Extraction Tool 189727-1 is designed to extract Mini-Universal MATE-N-LOK Contacts from housing cavities. Refer to AMP Catalog 82331 for selection information. Read this sheet carefully before using the tool.


2. DESCRIPTION (Figure 1)

This tool consists of a push rod button, push rod, handle, and steeve. The sleeve is inserted into the making face of the housing, depressing the locking lances of the crimped contact, and allowing the contact to be extracted from the wire-entry face of the housing.

3. EXTRACTION PROCEDURE

To extract a crimped contact from a housing, proceed as follows:

- Place sieeve of tool over contact to be removed, and at the same time, grasp wire of contact. Push contact toward mating face of connector and hold in this position. This will disengage contact locking lance from shoulder of cavity. See Figure 2, Detail A.
- 2. While holding wire, insert sleave straight into the contact cavity until it bottoms. Allow the push rod button to back out of the handle as shown in Figure 2, Detail B.

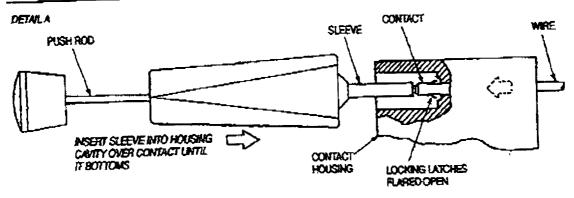



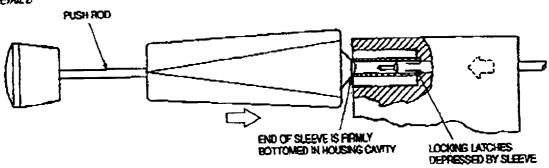


Figure 2

96-8 1012

PA 17KS TECHNICAL ASSISTANCE CENTER 1-800-722-1111 AMP FAXIFICODOCT NEO 1-800-522-5/82 This JAPP controlled document is subject to change. For industriation call the AMP FAX member. GCopylight TRICS by NAP transparated, All Fights Reserved.

LOC B

amp

Extraction Tool 189727-1

408 4118

- 3. Plotate handle to ensure the contact locking tance has been released.
- 4. Keep the sleeve firmly bottomed in the cavity and depress the push rod button. The contact will eject as the button is depressed. See Figure 3.
- 5. Remove the tool from the cavity.

4. MAINTENANCE AND INSPECTION

To ensure proper operation, it is recommended that the tool be inspected immediately on its arrival and at regularly scheduled intervals. The tool is not repairable and should be replaced when worn or damaged. It is recommended that the tool be stored in a clean, dry place and cleaned with a soft, lint-free doth.

Additional tools can be purchased from:

CUSTOMER SERVICE (38-35) AMP INCORPORATED P.O. BOX 3608 HARRISBURG, PA 17105-3608

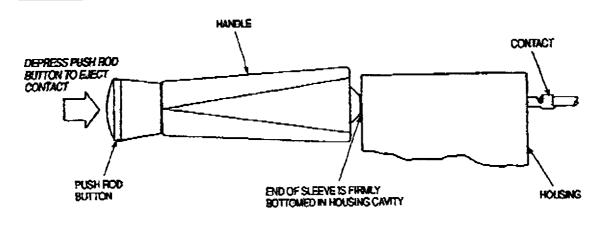


Figure 3

85-8

161-079 36 408013 LINDA J : UT2 CATCON - 0/10

Ţ




JUN 26 '00 14:56

AMP* PRO-CHIMPER* II Hand Tool Assembly 90759-1 with Die Assembly 90759-2 Instruction Sheet
408-9962
10-JAN 55 Rev A

PROPER USE GUIDELINES

Completive Traums Disorders consequitions the prolonged upon quantity powered hand tools. AMP turns and sended for occasional use and low volume applications. AMP offers a wide selection of powered application equipment for extended—use, production eperations.

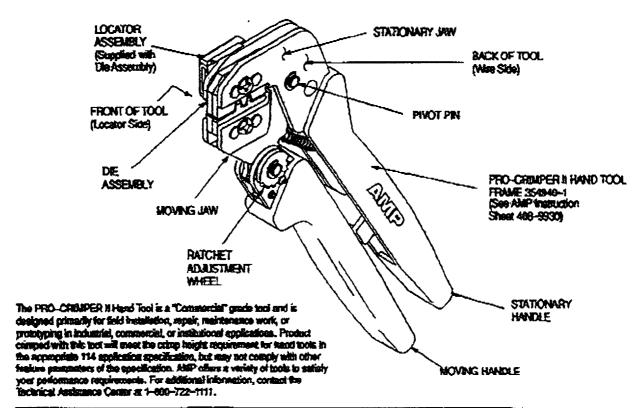

DEC ACCUMAN	1001707 1004	ASSY CONTACT SEE (ANG)	WRE		
DIE ASSEMBLY PART NAMBER	LOCATOR ASSY PART NUMBER			INSUL DIA	(mm [in.])
90759-2	58516 –1	Mini Universal MATE-N-LOK	22~20	1.594a2.39 [.6594a.094] OR	3.20 to 3.71 {.126 to .146} OR
			18, (2) 22	(2) 3.38 max [(2) .133 max]	(2) 3.50 to 3.59 (2) .138 to .157)

[†] Supplied with the assembly, also available separately.

Contact the AMP Technical Assistance Center (see below) for specific contact part numbers.

Figure 1

1. INTRODUCTION

AMP PRO-CRIMPER II Hand Tool
Assembly 90759-1 consists of Die Assembly
90759-2 and AMP PRO-CRIMPER II Hand Tool
Frame 354940-1. The die assembly consists of
crimping dies and a locator assembly. Read these
instructions thoroughly before crimping any contacts.



Dimensions on this sheet are in millimesers fuith inch-equivalents provided in brackets), Figures and illustrations are for identification only and are not drawn to scale.

Reasons for reissue are provided in Section 11, REVISION SUMMARY.



AMP PRO-CRIMPER II Hand Tool Assembly and Die Assembly

408-9962

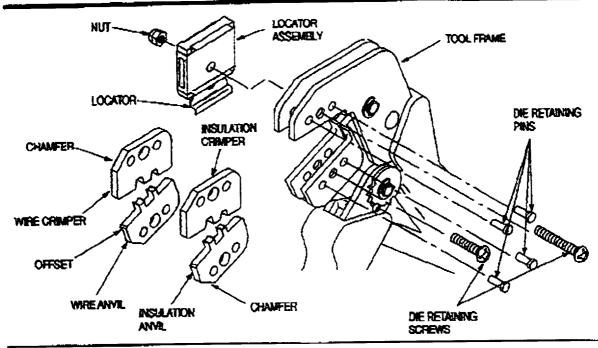


Figure 2

2. DESCRIPTION (Figures 1 and 2)

The tool features a tool frame with a stationary jaw and handle, a moving jaw, a moving handle, and an adjustable ratchet that ensures full contact crimping. The tool frame holds a die assembly with two crimping sections.

The die assembly features a wire anvil, an insulation anvil, a wire crimper, and an insulation crimper.

Attached to the outside of the frame is a locator assembly, which contains a locator, a spring retainer, and a contact support.

Die retaining pins and die retaining screws are used to position and secure the dies in the tool frame. A nut is used on the upper die retaining screw to hold the locator assembly in place.

3. INSTALLATION AND REMOVAL OF DIE SET AND LOCATOR ASSELBELY (Figure 2)

- Open the tool handles and remove the two die retaining screws from the fool jaws.
- Ptace the wire anvil and insulation anvil so that their chamfered sides and their marked surfaces face outward, when mounted in the moving jaw of the tool frame.
- 3. Insert the two die retaining pins.
- 4. Insert the short die retaining screw through the jaw and through both arwil dies, and tighten the

screw just enough to hold the dies in place. Do not tighten the screw completely at this time.

- Place the wire crimper and insulation crimper so that their chamfered sides and their marked surfaces face outward, when mounted in the stationary jaw of the tool frame.
- 6. Insert the two die retaining pins.
- 7. Insert the long die retaining screw through the jaw and through both crimper dies, and tighten the screw just enough to hold the dies in place. Do not tighten the screw completely at this time.
- 8. Casefully close the tool handles, making sure that the anvils and crimpers align properly. Continue closing the tool handles until the ratchet in the tool frame has engaged sufficiently to hold the anvils and crimpers in place, then tighten both die retaining screws.
- Place the locator assembly over the end of the long screw, and position the locator assembly against the side of the tool jaw.
- 10. Place the nut onto the end of the long screw and tighten the nut enough to hold the locator assembly in place, while still allowing the locator to slide up and down.
- 11. To disassemble, close the tool handles until the ratchet releases, remove the nut, the locator assembly, the two die retaining screws, and the four die retaining pins, and slide the arrivis and crimpers out of the tool jaws.

TO 917739075180 PAGE. 006



AMP PRO-CEMPER II Hand Tool Assembly and Die Assembly

408-9962

4. CONTACT SUPPORT ADJUSTMENT (Figure 3)



The contact support is preset prior to shipment. but minor adjustment may be necessary.

- 1. Make a sample crimp and determine if the contact is straight, bending upward, or bending downward.
- 2. If adjustment is required, loosen the screw that holds the contact support onto the locator assembly.

HOTE

The reachet has detents that crosse audible clicks as the tool handles are closed.

- 3. Place a contact with wire into the proper nest and close the tool handles until the ratchet reaches the sixth click, or until the contact support touches the contact.
- 4. Slightly loosen the nut that holds the locator assembly onto the tool frame.
- 5. Move the contact support as required to eliminate the bending of the contact.
- 6. Tighten the nut and close the handles until the ratchet releases.
- Remove and inspect the confact.
- 8. Make another sample crimp. If the contact is straight, tighten the contact support screw. If the contact is still being bent during crimping, repeat the adjustment procedure.

NOTE

This tool is provided with a crimp adjustment teature. Initially, the crisip height should be verified as specified in Figure 4. Refer to Section 6, CRIMP HEIGHT INSPECTION, and Section 7, CRIMP HEIGHT ADJUSTMENT, to vecity crimp height before using the tool to crimp desired contacts and wire sizes.

Refer to the table in Figure 1 and select wire of the specified size and insulation diameter. Strip the wire to the length indicated in Figure 1, taking care not to nick or cult wire strands. Select an applicable contact and identify the appropriate crimp section according to the wire size markings on the tool. Refer to Figure 3 and proceed as follows:


- 1. Hold the tool so that the back (wire side) is tacing you. Squeeze tool handles together and allow them to open fully.
- 2. Holding the contact by the mating end, insert the contact - insulation barrel first - through the front of the tool and into the appropriate crimp section.
- 3. Position the contact so that the making end of the contact is on the locator side of the tool, and so that the open "U" of the wire and insulation barrels tace the top of the tool. Place the contact up into the nest so that the movable locator drops into the slot in the contact. Refer to Figure 3. Butt the front end of the wire barrel against the movable locator.

CAUTION

Make sure that both sides of the insulation barrel are started evenly into the crimping section. Do NOT assumpt to crimp an improperly positioned contact

4. Hold the contact in position and squeeze the tool handles together until ratchet engages

5. CREEPING PROCEDURE

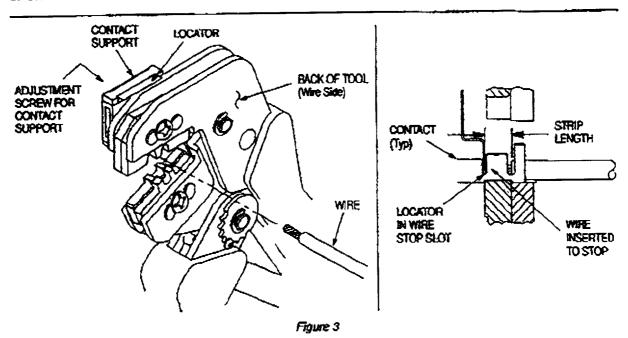

Rey A

AMP

JUN 26 '00 14:57

AMP PRO-CRIMPER II Hand Tool Assembly and Die Assembly

408-9962


sufficiently to hold the contact in position. Do NOT deform insulation barrel or wire barrel.

- Insert stripped wire into contact insulation and wire barrels until it is butted against the wire stop, as shown in Figure 3.
- 6. Holding the wire in place, squeeze tool handles together until ratchet releases. Allow tool handles to open and remove cramped contact.



The crimped contact may stick in the crimping area, but the contact can be easily removed by posting downward on the top of the locator (see Figure 3).

7. Check the contact's crimp height as described in Section 6, CRIMP HEIGHT INSPECTION. If necessary, adjust the crimp height as described in Section 7, CRIMP HEIGHT ADJUSTMENT.

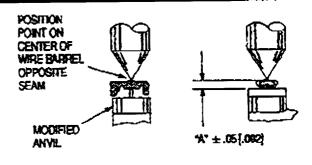

WIRE SIZE AWG (MAX)	CRIMP SECTION (WIRE SIZE MARKING)	CRIMP HEIGHT DUL (A)
20	22-20	.81 [.032]
18	14, (2) 22	1,02 [.040]

Figure 4

6. CRIMP HEIGHT INSPECTION

This inspection requires the use of a micrometer with a modified anvil. AMP recommends the modified micrometer (Crimp Height Comparator RS-1019-5LP) which may be purchased from:

Shearer todusated Supply Co. 20 North Penn Street York, PA. 17401-1014 VALCO 1410 Stonewood Drive Bethlehern, PA 18017-3527

Proceed as follows:

- 1. Refer to Figure 4 and select a wire (maximum size) for each crimp section listed.
- 2. Refer to Section 5, CRIMPING PROCEDURE, and crimp the contact(s) accordingly.
- 3. Using a crimp height comparator, measure the wire barrel crimp height as shown in Figure 4. If the crimp height conforms to that shown in the table, the tool is considered dimensionally correct. If not, the tool must be adjusted. Refer to Section 7, CRIMP HEIGHT ADJUSTMENT.

7. CRIMP HEIGHT ADJUSTMENT (Figure 5)

- 1. Remove the lockscrew from the ratchet adjustment wheel.
- 2. With a screwdriver, adjust the ratchet wheel from the locator side of the tool.

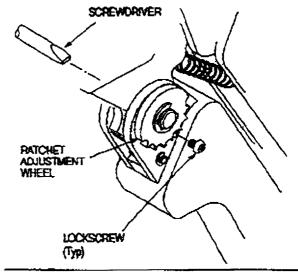


Figure 5

408-9962



JUN 26 '00 14:57

AMP PRO-CRIMPER II Hand Tool Assembly and Die Assembly

- 3. Observe the ratchet adjustment wheel. If a tighter crimp is required, rotate the adjustment wheel COUNTERCLOCKWISE to a higher-numbered setting. If a looser crimp is required, sotate the adjustment wheel CLOCKWISE to a lower-numbered setting.
- 4. Replace the lockscrew.
- 5. Make a sample crimp and measure the crimp height. If the dimension is acceptable, replace and secure the lockscrew. If the dimension is unacceptable, continue to adjust the ratchet, and again measure a sample crimp.

8. HANTENANCE

Ensure that the tool and dies are clean by wiping them with a clean, soft cloth. Remove any debris with a clean, soft brush. Do not use objects that could damage the tool. When not in use, keep handles closed to prevent objects from becoming lodged in the crimping cles, and store in a clean, dry area.

9. VISUAL INSPECTION

The crimping dies should be inspected on a regular basis to ensure that they have not become wom or damaged. Inspect the crimp sections for flattened, chipped, worn, or broken areas. If damage or abnormal wear is evident, the tool must be replaced. See Section 10, FIEPLACEMENT.

10, REPLACEMENT

Customer-replaceable parts are shown in Figure 1. Available separately, AMP PRO-CREMPER It Repair Kit 679221-1 includes a replacement nut and a variety of pins, rings, screws, and springs. If the dies are damaged or worn excessively, they must be replaced. Order the repair kit and replaceable parts through your AMP representative, or call 1-800-526-5142, or send a facsimile of your purchase order to 1-717-986-7605, or write to:

CUSTOMER SERVICE (38-35) AMP INCORPORATED P.O. BOX 3608 HARRISBURG, PA 17105-3608

11. REVISION SUMMARY

Since the previous release of this sheet, the following changes were made:

Per EC 0150-3338-95

- Added note in Figure 1.
- Deleted note in Section 1, INTRODUCTION.
- Changed Crimp Height Comparator RH-1019-LAP to RS-1019-5LP.
- Changed York Machinery & Supply Co. to Shearer Industrial Supply Co.

Per EC 0990-0252-93

Added "REVISION SUMMARY."

Roy A