



## IEC plug

1 or 2 fuses 5 x 20 mm

High performance compact filter

E-version: suppression of HF interference on earth wire and equipment ground by earth line choke

| FN 360, FN 361 | Rated current A |      | Leakage current<br>220V/50Hz | Inductance |   | Fuse    | Connections |                                  | Weight<br>g   |
|----------------|-----------------|------|------------------------------|------------|---|---------|-------------|----------------------------------|---------------|
|                | 40°C            | 25°C |                              | mH         |   |         | Input       | Output                           |               |
| ♥ FN 360-1/06  | 1               | 1.2  | 2 x 0.21 mA                  | 7.5        | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 360-2/06  | 2               | 2.4  | 2 x 0.21 mA                  | 2          | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 360-4/06  | 4               | 4.8  | 2 x 0.21 mA                  | 0.75       | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 360-6/06  | 6               | 7.3  | 2 x 0.21 mA                  | 0.45       | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361-1/06  | 1               | 1.2  | 2 x 0.21 mA                  | 7.5        | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361-2/06  | 2               | 2.4  | 2 x 0.21 mA                  | 2          | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361-4/06  | 4               | 4.8  | 2 x 0.21 mA                  | 0.75       | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361-6/06  | 6               | 7.3  | 2 x 0.21 mA                  | 0.45       | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |

## FN 360E, FN 361E, with earth line choke

|                |   |     |             |      |   |         |             |                                  |               |
|----------------|---|-----|-------------|------|---|---------|-------------|----------------------------------|---------------|
| ♥ FN 360E-1/06 | 1 | 1.2 | 2 x 0.21 mA | 7.5  | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 360E-2/06 | 2 | 2.4 | 2 x 0.21 mA | 2    | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 360E-4/06 | 4 | 4.8 | 2 x 0.21 mA | 0.75 | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 360E-6/06 | 6 | 7.3 | 2 x 0.21 mA | 0.45 | 2 | 2 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361E-1/06 | 1 | 1.2 | 2 x 0.21 mA | 7.5  | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361E-2/06 | 2 | 2.4 | 2 x 0.21 mA | 2    | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361E-4/06 | 4 | 4.8 | 2 x 0.21 mA | 0.75 | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |
| ♥ FN 361E-6/06 | 6 | 7.3 | 2 x 0.21 mA | 0.45 | 1 | 1 Ø5x20 | IEC 320 C14 | soldering lugs/fast-on 6.3 x 0.8 | 110 X X X X X |


♥ stock types

FN 360, 361

FN 360E, 361E


X = approved

Operating voltage 250 V max.  
 Operating frequency DC to 400 Hz max.  
 Temperature range - 25°C to + 85°C  
 Test voltage P/N → E 2 kV/50 Hz

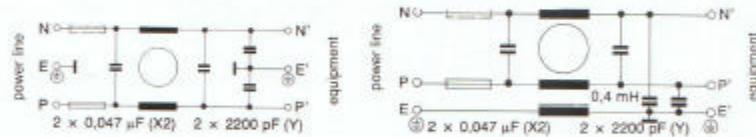

For further information, see general part.

### Insertion loss

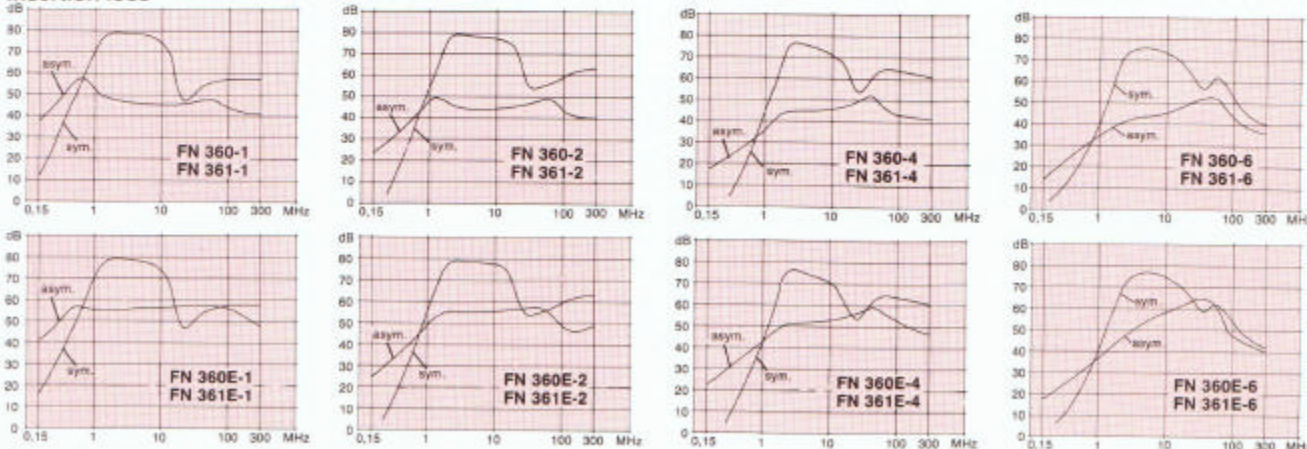

### Dimensions

