

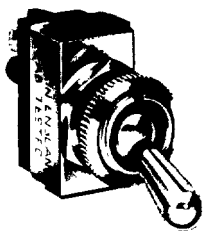


421 996

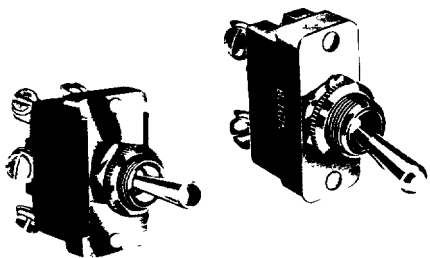


SM0259/PD

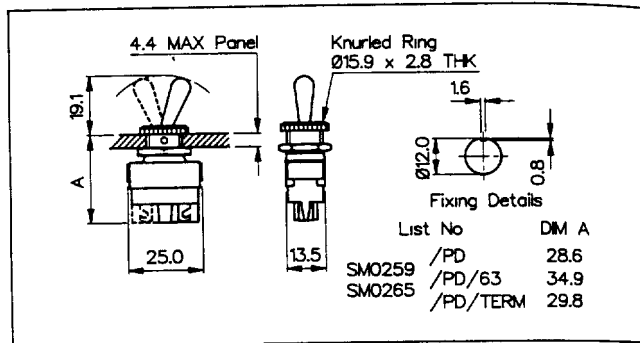

SX0780

SX0790

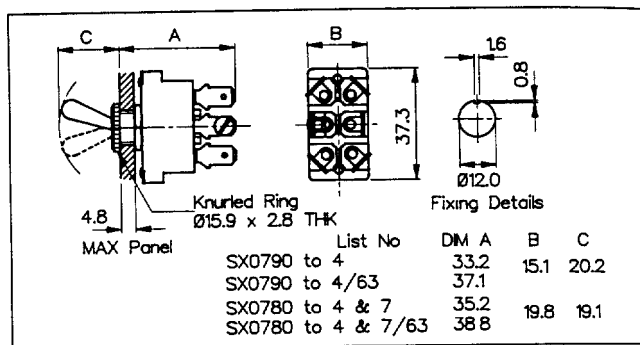

SWITCHES



Single Pole List No.	Double Pole List No.	Description	1	2	3
SX0790	SX0780	Change-over Centre-off.	ON	OFF	ON
SX0791	-	Change-over. Centre-off. One position biased off	ON	OFF	ON
SX0792	SX0782	Change-over Centre-off Two positions biased off	ON	OFF	ON
SX0793	SX0783	Change-over Two positions only	ON	-	ON
SX0794	SX0784	ON/OFF Two positions only	OFF	-	ON
-	SX0787	Change-over Two positions only, biased to one position	ON	-	ON

Data	List No.	SM0259/PD, SM0265/PD	SX0780, SX0790 Series
Terminations:		Solder tags	Screw terminals.
Switching:		SM0259/PD S.P.M.B. 1 pair of contacts (Quick Make/Break) SM0265/PD S.P.C.O 2 pairs of contacts. (Quick Make/Break).	See table for types. Slow Make, Slow Break.
Max. Rating:		SM0259/PD 3A 250V a.c. SM0265/PD 2A 250V a.c.	10A 250V. a.c. 10A 0-28V. d.c. (non-reactive circuits)
Contact Resistance:		<10 mΩ.	<10 mΩ.
Insulation Resistance:		>10 ³ MΩ.	>10 ³ MΩ.
Dielectric Strength:		>4.5kV. a.c.	>2.5kV a.c.
Operating Temp. Range:		-20°C to +70°C.	-20°C to +85°C.
Materials:		Mouldings: Phenolic. Tags: Brass, Silver Plated.	Mouldings: Phenolic. Terms: Brass, Silver Plated.
Contacts:		Brass, Silver Plated.	Copper with Silver face
Variants:		For Screw Terminals add /TERM to List No. (Not SM0265/PD) For 6.3mm tab (to agreed orders) add /63 to List No.	For 6.3 series tabs (to agreed orders) add /63 to List No. (Not SX0791)
Accessories:		SX0550, P.No. 5943 (See Page 178). NX1030 & /B (See Page 178).	